

INFORMATION : FAULT CODE P1435 (ENGINE ECU)*DV6C TURBO DIESEL*

Engine ECU CONTINENTAL SID 807 branch 2	
Fault code	P1435
After sales description of the fault code	Multiplexed additive pump : CAN network fault or pump fault
Description of the diagnostics	Possibility 1 Multiplexed additive pump fault detected for 10 second
	Possibility 2 Fault in communication between the built-in systems interface and the additive pump detected for 10 second
Conditions of activation of the diagnostics	Engine running
Conditions of disappearance of the fault	The following conditions have to be met - Addition of 10 litres of fuel - Driving with the engine hot for 5 minutes
Down-grade modes if fault present	Transmission to the multifunction screen of "risk of clogging of the particle filter"
Switching on of the warning light and/or warning message	Warning lamp SERVICE
Main customer complaints likely	Fluid leak/smells (diesel fuel, oil, etc.)
	No effects immediately perceptible to the customer
Suspect areas	Soft pouch/Particle filter additive reservoir
	Additive pump TI
	Additive pump MGI